



# Technical News

Sony Imaging Products & Solutions Inc. © 2021

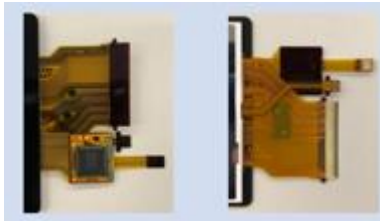
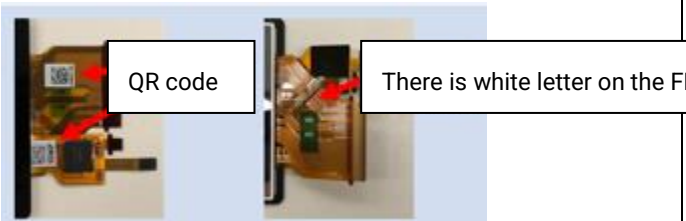
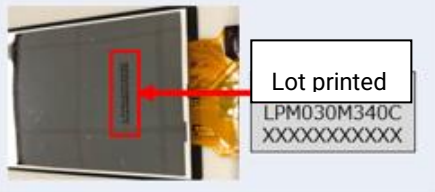
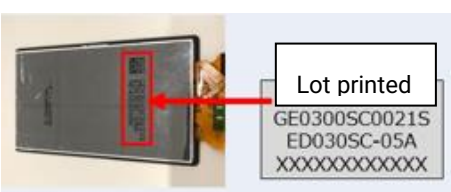
Ref. No.	Issuer company	Issue (yyyy/mm/dd)	Last modification (yyyy/mm/dd)
PV20NEX534	Digital Imaging Group	2021/04/28	
<b>Subject</b>			
Repair services to replace LCD panels			
Model (System model)	Destination	Serial number	Color
ILCE-6400	All	ALL	All

## **SYMPTOM**

SY bord and software both need to change, because LCD panel maker changed.

## **SOLUTION**

Refer the table how to distinguish LCD module.

	JDI Current product	Innolux Modified product
Part name	LPM030M340C	ED030SC-05A
Part number	1-812-461-11/-21	1-009-402-11
FPC		
FPC		

Conditions of Use

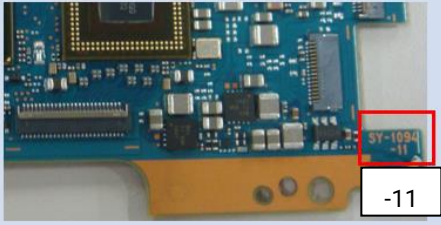
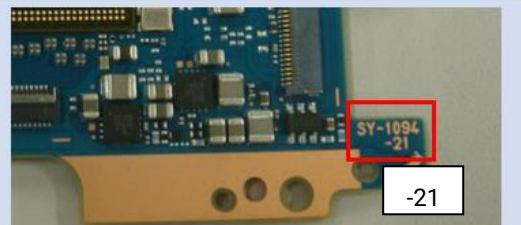
(1) Only Sony Group employees are permitted to access and use this information. To disclose or disseminate to any other parties is forbidden.

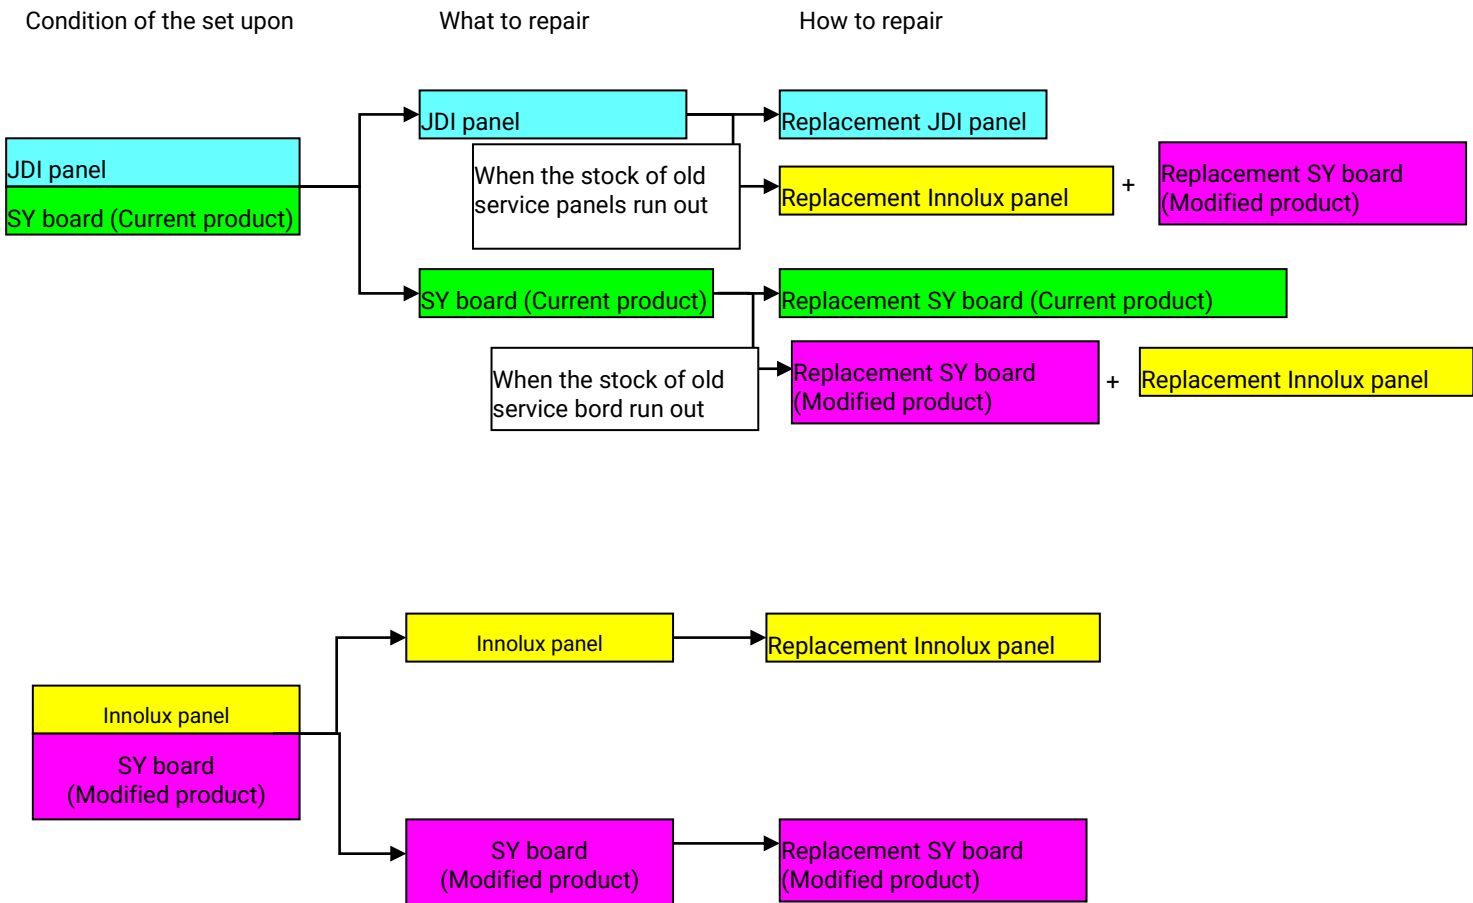
(2) Destroy or erase any and all portion of this information promptly in an irreversible and secure fashion after achieving the purpose of use of this information.

(3) Do not copy, replicate, reproduce, alter, translate, transmit, sell, lease, or distribute this information in whole or in part without the prior written permission of the author.

(Notwithstanding foregoing, it is permitted to copy and distribute this information to the Sony Group employees whose duties it need to know.)

How to distinguish old SY board and new one. (ILCE-6400)

	Current product	Modified product
Part name	SY-1094	SY-1094
Part number	A-5009-198-A	A-5031-600-A
SY Board		



-The service main board is equipped with a corresponding panel FW at end. When writing to the destination, select according to the corresponding panel.  
 -When using a new board, please use a version newer than "ILCE-6400\_Series\_AM\_Ver\_1.4\_x64" for the adjustment software.

